

Утверждаю
Исполнительный директор
_____ Морозов С. И.
«___» _____ 2025

**ТЕХНИЧЕСКИЕ РЕКОМЕНДАЦИИ
НА УСТАНОВКУ БЫТОВЫХ КОНДИЦИОНЕРОВ ДЛЯ
ЖИЛЫХ И НЕЖИЛЫХ ПОМЕЩЕНИЙ В
МНОГОКВАРТИРНОМ ДОМЕ:**

Проспект Авиастроителей, д.22

1. Монтаж системы кондиционирования необходимо выполнять с учетом настоящих технических условий (далее ТУ), инструкцией по монтажу, прилагаемой к системе кондиционирования и правил проведения строительно-монтажных, электротехнических и иных работ, действующих на территории РФ.

2. Внешние блоки сплит-систем кондиционирования следует располагать в специальных корзинах заводского исполнения, расположение которых указано в Приложении №1 к данным рекомендациям.

3. Монтаж внешнего блока необходимо производить с помощью адаптивных кронштейнов корзины или опор на внешней стороне фасада здания, по центру относительно вертикали окна, не выходя за его пределы, 20 см ниже оконного отлива

Чтобы полностью исключить попадание конденсата на ограждающие конструкции здания, рекомендуется предусматривать отвод конденсата в квартирную хоз.-бытовую канализацию.

4. При технической необходимости установки внешнего блока на внешней части фасада, внутри или снаружи лоджии необходимо руководствоваться схемой, указанной в Приложении №2 к данным рекомендациям.

5. Корзины и внешний блок кондиционера, установленные на фасаде и лоджиях необходимо монтировать по схеме для соответствующего типа фасада (вентилируемый фасад, штукатурный фасад; кирпичная или железобетонная несущая конструкция), указанной в Приложении №3 к данным рекомендациям.

6. Внешний блок кондиционера необходимо закрыть в декоративный металлический короб (корзину) с антикоррозийной защитой. Корзины должны быть рассчитаны на массу внешнего блока и выполнены в соответствии эскизом, указанным в Приложении №4 к данным рекомендациям.

7. Изготовитель корзин для проекта – компания Морион г. Челябинск, телефон для заказа дополнительных корзин – 8 919 324 10 20.

8. Корзина должен быть выполнена согласно чертежу и в цвет фасада, на который он устанавливается, RAL и соответствовать одному из утвержденных колеров:

RAL 7006, RAL 7042, RAL 1034, RAL 1036

9. Прокладку коммуникаций до внешнего блока следует осуществлять скрытно, внутри помещения. Прокладка коммуникаций по внешней стороне фасада строго запрещена.

10. Допускается устройство сквозных технологических отверстий в несущих конструкциях внутренних и наружных стен диаметром до 60 мм. Необходимо заделать и загерметизировать отверстия в местах прохождения коммуникаций через ограждающие конструкции для исключения в дальнейшем промерзания несущих конструкций, плесени и попадания влаги внутрь жилого/нежилого помещения.

11. При выборе типа кондиционера необходимо учитывать шумовые характеристики внешнего блока, согласно СНиП 23-03-2003.

12. Подключение кондиционера к электросети квартиры в пределах выделенной мощности рекомендуется производить через дополнительную защитную аппаратуру (автоматические выключатели, устройства защитного отключения).


Электромонтажные работы должны проводиться в соответствии с требованиями ПУЭ (правил устройства электроустановок).

13. Все работы, которые могут негативно повлиять на жизнь и здоровье человека, должны выполняться в соответствии с правилами техники безопасности при монтаже кондиционеров.

Рекомендуется проводить регулярное обслуживание узлов системы кондиционирования (очистка и заправка фреоном), проведение данных мероприятий позволит использовать систему в течение длительного времени.

Ответственность за сохранность наружных блоков кондиционеров, форс-мажорные обстоятельства при монтаже и последствия функционирования кондиционеров, а также за разрушения конструкции

здания несет на себе собственник помещения, производивший монтаж кондиционера.

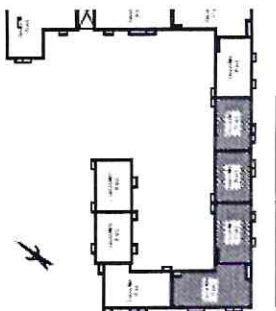




Условные обозначения

- | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|--|
|  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  | |
|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|--|






Фасад в осев 9-1 (секции 11-9)

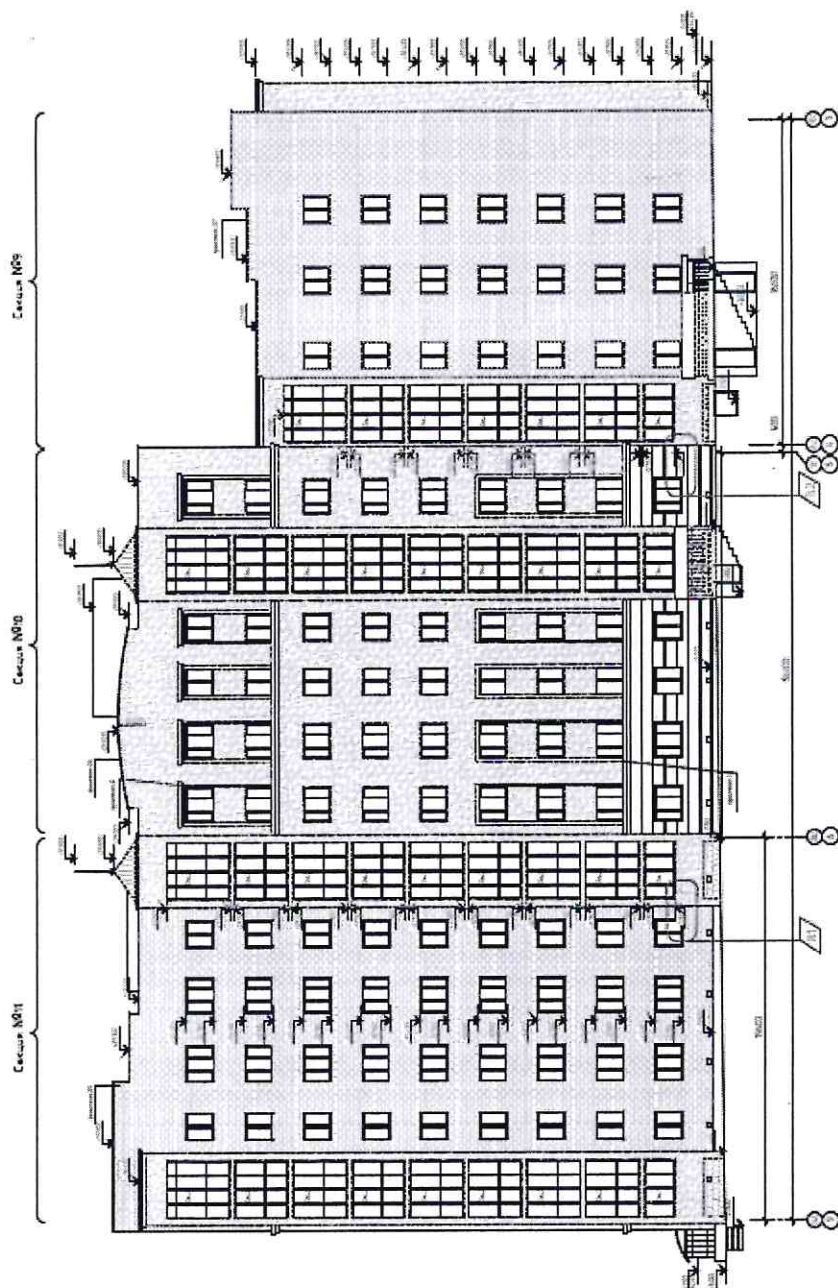


Фасад в осек 11-3 (секции 5-8)

Секция №5 Секция №6 Секция №7 Секция №8

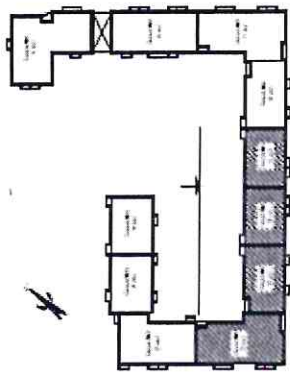
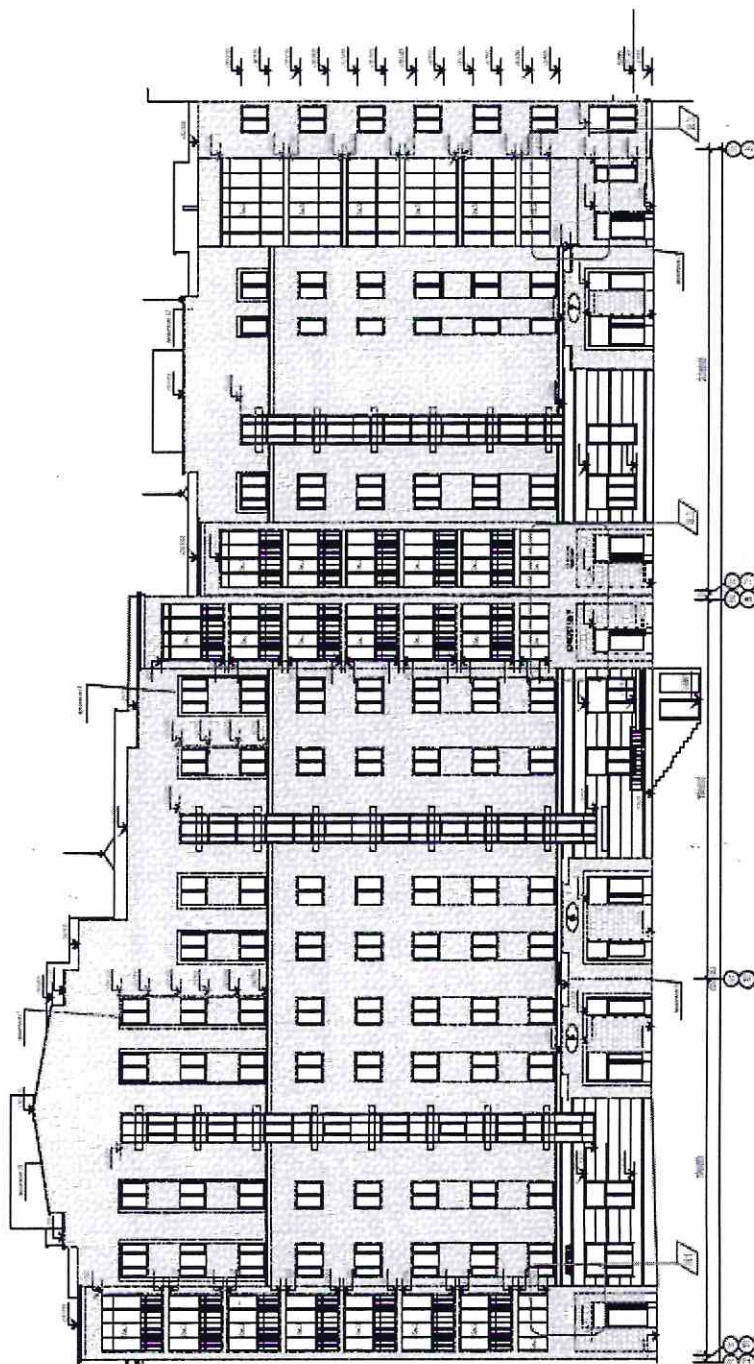


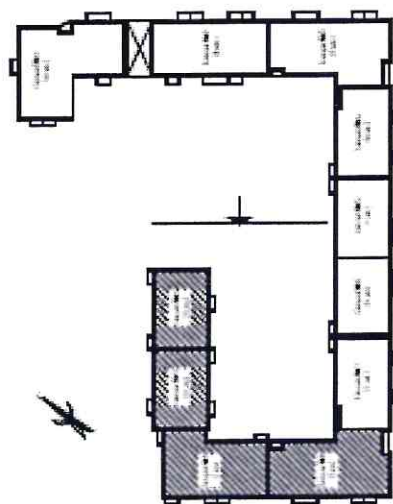


Фасад в осях 5-11 (секции 8-11)

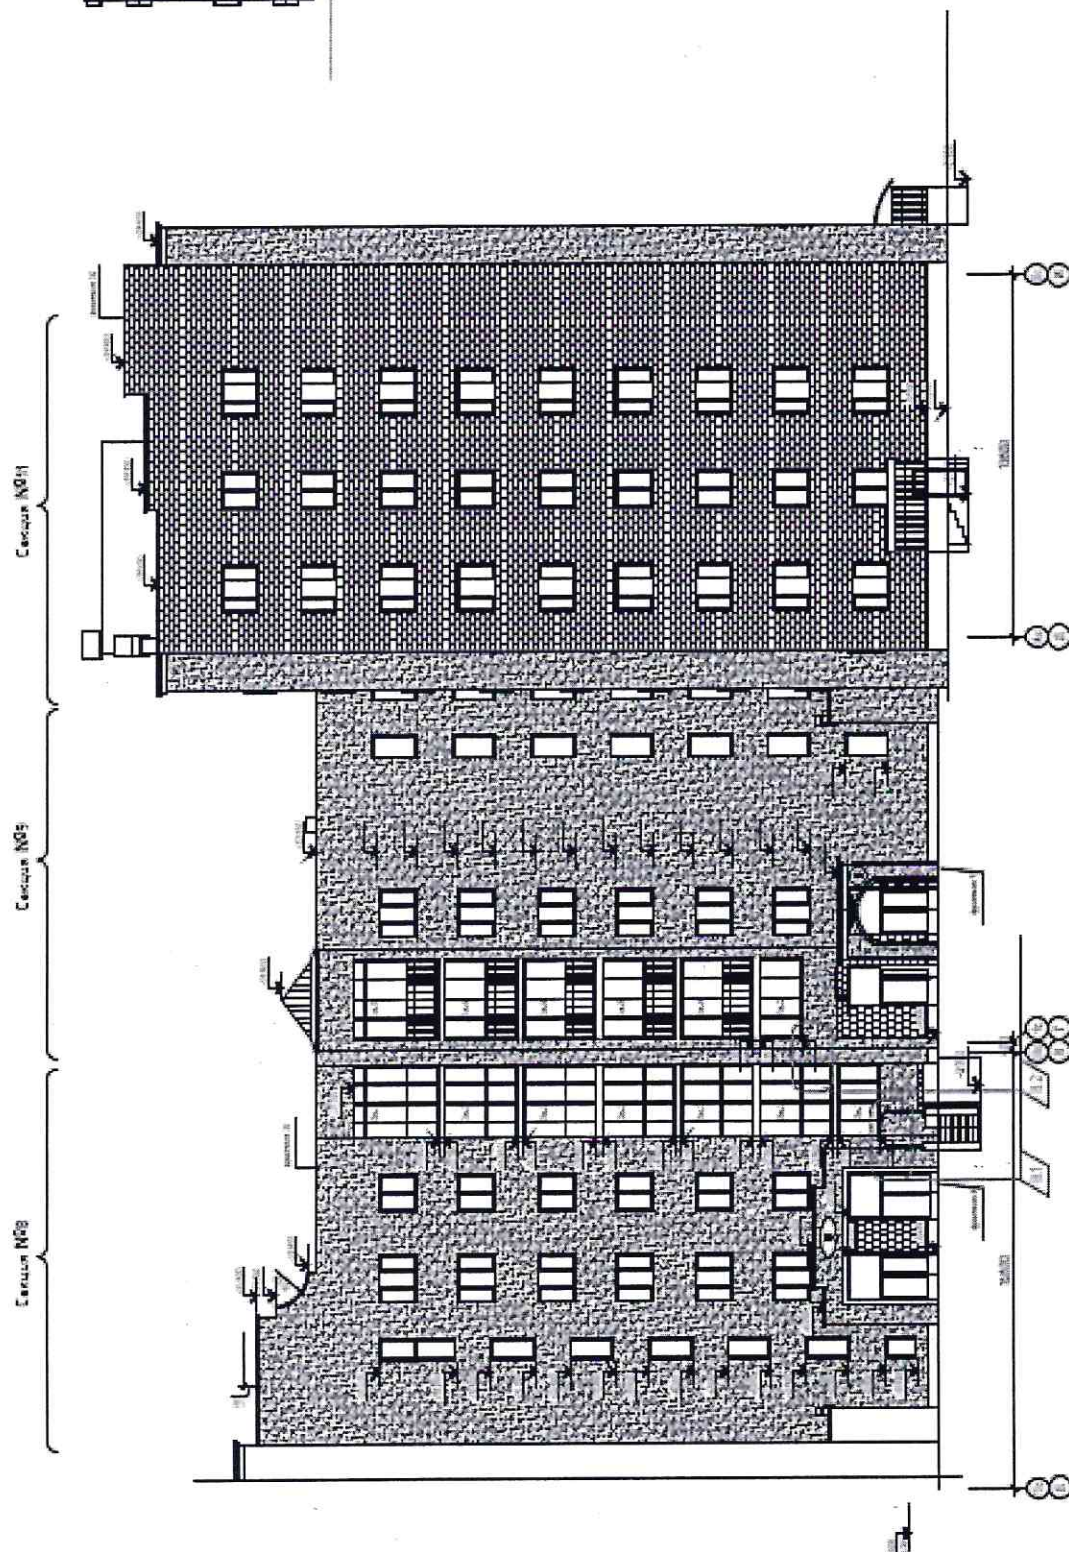


Фасад в осях 2-9 (секции 9-10)

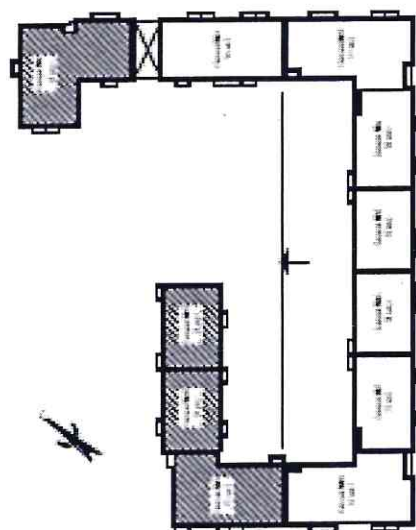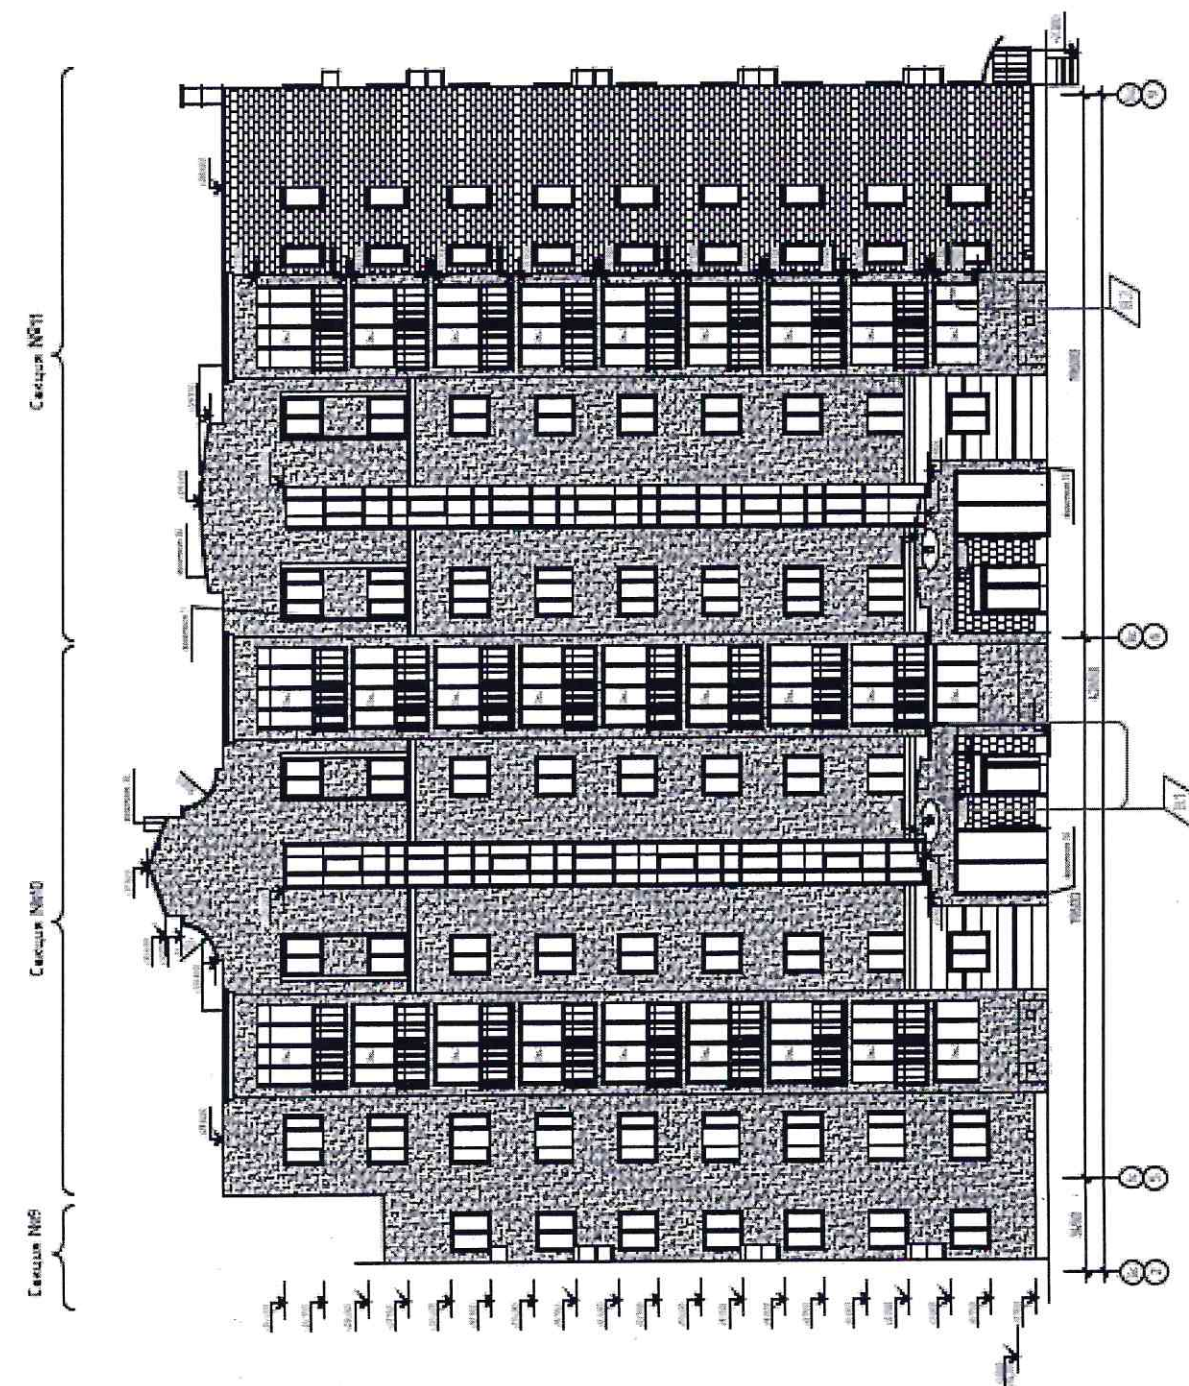

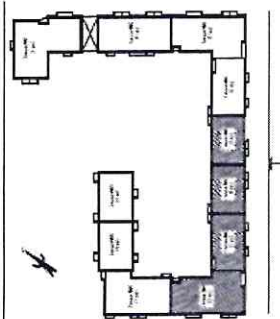

Фасад в осях И-А (секции 9, 8)

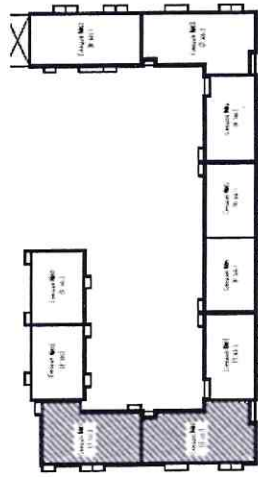


Секция №9

Секция №8

стеклопакет
панель «Свет» МБРА-2/А.1

фасадные элементы окон РАЛ 7012

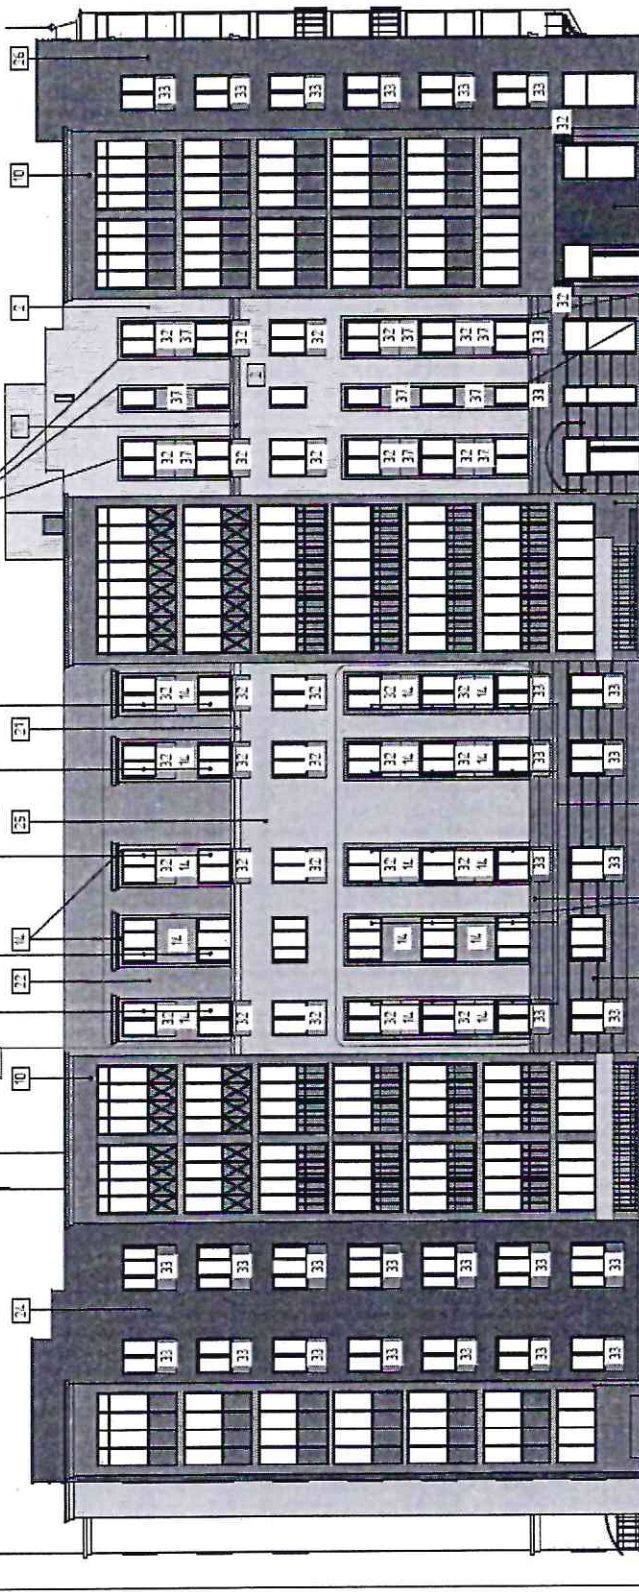


Корпус для радиоточечной информации
размещается в этом корпусе

32 - РА, 7012
33 - РА, 7006


1. Вентильный корпус - вентиляционный корпус с автоматическим управлением
2. Вентильный корпус - вентиляционный корпус с автоматическим управлением
3. Вентильный корпус - вентиляционный корпус с автоматическим управлением
4. Вентильный корпус - вентиляционный корпус с автоматическим управлением
5. Вентильный корпус - вентиляционный корпус с автоматическим управлением
6. Вентильный корпус - вентиляционный корпус с автоматическим управлением
7. Вентильный корпус - вентиляционный корпус с автоматическим управлением

10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100 101 102 103 104 105 106 107 108 109 110 111 112 113 114 115 116 117 118 119 120 121 122 123 124 125 126 127 128 129 130 131 132 133 134 135 136 137 138 139 140 141 142 143 144 145 146 147 148 149 150 151 152 153 154 155 156 157 158 159 160 161 162 163 164 165 166 167 168 169 170 171 172 173 174 175 176 177 178 179 180 181 182 183 184 185 186 187 188 189 190 191 192 193 194 195 196 197 198 199 200 201 202 203 204 205 206 207 208 209 210 211 212 213 214 215 216 217 218 219 220 221 222 223 224 225 226 227 228 229 230 231 232 233 234 235 236 237 238 239 240 241 242 243 244 245 246 247 248 249 250 251 252 253 254 255 256 257 258 259 260 261 262 263 264 265 266 267 268 269 270 271 272 273 274 275 276 277 278 279 280 281 282 283 284 285 286 287 288 289 290 291 292 293 294 295 296 297 298 299 300 301 302 303 304 305 306 307 308 309 310 311 312 313 314 315 316 317 318 319 320 321 322 323 324 325 326 327 328 329 330 331 332 333 334 335 336 337 338 339 340 341 342 343 344 345 346 347 348 349 350 351 352 353 354 355 356 357 358 359 360 361 362 363 364 365 366 367 368 369 370 371 372 373 374 375 376 377 378 379 380 381 382 383 384 385 386 387 388 389 390 391 392 393 394 395 396 397 398 399 400 401 402 403 404 405 406 407 408 409 410 411 412 413 414 415 416 417 418 419 420 421 422 423 424 425 426 427 428 429 430 431 432 433 434 435 436 437 438 439 440 441 442 443 444 445 446 447 448 449 450 451 452 453 454 455 456 457 458 459 460 461 462 463 464 465 466 467 468 469 470 471 472 473 474 475 476 477 478 479 480 481 482 483 484 485 486 487 488 489 490 491 492 493 494 495 496 497 498 499 500 501 502 503 504 505 506 507 508 509 510 511 512 513 514 515 516 517 518 519 520 521 522 523 524 525 526 527 528 529 530 531 532 533 534 535 536 537 538 539 540 541 542 543 544 545 546 547 548 549 550 551 552 553 554 555 556 557 558 559 560 561 562 563 564 565 566 567 568 569 570 571 572 573 574 575 576 577 578 579 580 581 582 583 584 585 586 587 588 589 590 591 592 593 594 595 596 597 598 599 600 601 602 603 604 605 606 607 608 609 610 611 612 613 614 615 616 617 618 619 620 621 622 623 624 625 626 627 628 629 630 631 632 633 634 635 636 637 638 639 640 641 642 643 644 645 646 647 648 649 650 651 652 653 654 655 656 657 658 659 660 661 662 663 664 665 666 667 668 669 670 671 672 673 674 675 676 677 678 679 680 681 682 683 684 685 686 687 688 689 690 691 692 693 694 695 696 697 698 699 700 701 702 703 704 705 706 707 708 709 710 711 712 713 714 715 716 717 718 719 720 721 722 723 724 725 726 727 728 729 730 731 732 733 734 735 736 737 738 739 740 741 742 743 744 745 746 747 748 749 750 751 752 753 754 755 756 757 758 759 760 761 762 763 764 765 766 767 768 769 770 771 772 773 774 775 776 777 778 779 780 781 782 783 784 785 786 787 788 789 790 791 792 793 794 795 796 797 798 799 800 801 802 803 804 805 806 807 808 809 810 811 812 813 814 815 816 817 818 819 820 821 822 823 824 825 826 827 828 829 830 831 832 833 834 835 836 837 838 839 840 841 842 843 844 845 846 847 848 849 850 851 852 853 854 855 856 857 858 859 860 861 862 863 864 865 866 867 868 869 870 871 872 873 874 875 876 877 878 879 880 881 882 883 884 885 886 887 888 889 890 891 892 893 894 895 896 897 898 899 900 901 902 903 904 905 906 907 908 909 910 911 912 913 914 915 916 917 918 919 920 921 922 923 924 925 926 927 928 929 930 931 932 933 934 935 936 937 938 939 940 941 942 943 944 945 946 947 948 949 950 951 952 953 954 955 956 957 958 959 960 961 962 963 964 965 966 967 968 969 970 971 972 973 974 975 976 977 978 979 980 981 982 983 984 985 986 987 988 989 990 991 992 993 994 995 996 997 998 999 1000.

10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100 101 102 103 104 105 106 107 108 109 110 111 112 113 114 115 116 117 118 119 120 121 122 123 124 125 126 127 128 129 130 131 132 133 134 135 136 137 138 139 140 141 142 143 144 145 146 147 148 149 150 151 152 153 154 155 156 157 158 159 160 161 162 163 164 165 166 167 168 169 170 171 172 173 174 175 176 177 178 179 180 181 182 183 184 185 186 187 188 189 190 191 192 193 194 195 196 197 198 199 200 201 202 203 204 205 206 207 208 209 210 211 212 213 214 215 216 217 218 219 220 221 222 223 224 225 226 227 228 229 230 231 232 233 234 235 236 237 238 239 240 241 242 243 244 245 246 247 248 249 250 251 252 253 254 255 256 257 258 259 260 261 262 263 264 265 266 267 268 269 270 271 272 273 274 275 276 277 278 279 280 281 282 283 284 285 286 287 288 289 290 291 292 293 294 295 296 297 298 299 300 301 302 303 304 305 306 307 308 309 310 311 312 313 314 315 316 317 318 319 320 321 322 323 324 325 326 327 328 329 330 331 332 333 334 335 336 337 338 339 340 341 342 343 344 345 346 347 348 349 350 351 352 353 354 355 356 357 358 359 360 361 362 363 364 365 366 367 368 369 370 371 372 373 374 375 376 377 378 379 380 381 382 383 384 385 386 387 388 389 390 391 392 393 394 395 396 397 398 399 400 401 402 403 404 405 406 407 408 409 410 411 412 413 414 415 416 417 418 419 420 421 422 423 424 425 426 427 428 429 430 431 432 433 434 435 436 437 438 439 440 441 442 443 444 445 446 447 448 449 450 451 452 453 454 455 456 457 458 459 460 461 462 463 464 465 466 467 468 469 470 471 472 473 474 475 476 477 478 479 480 481 482 483 484 485 486 487 488 489 490 491 492 493 494 495 496 497 498 499 500 501 502 503 504 505 506 507 508 509 510 511 512 513 514 515 516 517 518 519 520 521 522 523 524 525 526 527 528 529 530 531 532 533 534 535 536 537 538 539 540 541 542 543 544 545 546 547 548 549 550 551 552 553 554 555 556 557 558 559 560 561 562 563 564 565 566 567 568 569 570 571 572 573 574 575 576 577 578 579 580 581 582 583 584 585 586 587 588 589 590 591 592 593 594 595 596 597 598 599 600 601 602 603 604 605 606 607 608 609 610 611 612 613 614 615 616 617 618 619 620 621 622 623 624 625 626 627 628 629 630 631 632 633 634 635 636 637 638 639 640 641 642 643 644 645 646 647 648 649 650 651 652 653 654 655 656 657 658 659 660 661 662 663 664 665 666 667 668 669 670 671 672 673 674 675 676 677 678 679 680 681 682 683 684 685 686 687 688 689 690 691 692 693 694 695 696 697 698 699 700 701 702 703 704 705 706 707 708 709 710 711 712 713 714 715 716 717 718 719 720 721 722 723 724 725 726 727 728 729 730 731 732 733 734 735 736 737 738 739 740 741 7

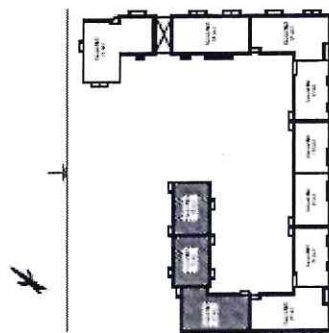

671 mm x 91 cm

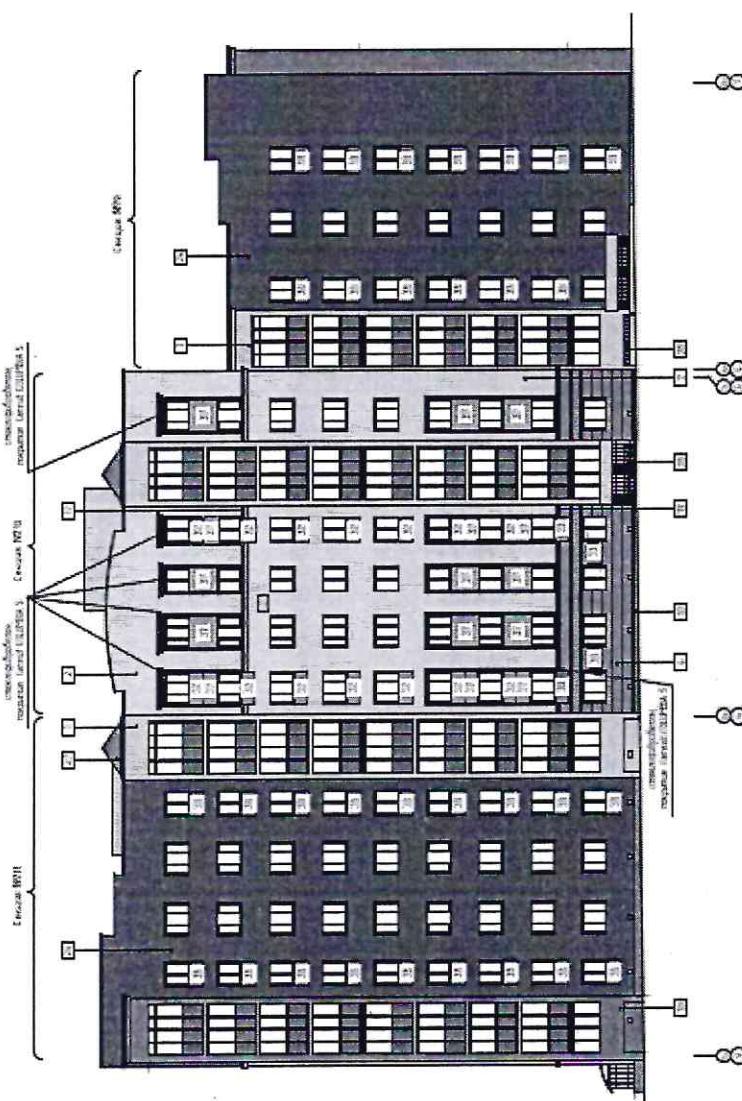


အိတ်ကလေးတစ်ခုကို အသုံးပြု

1.           
2.           
3.           
4.           
5.           
6.           
7.           
8.           
9.           
10.           
11.           
12. 


- | | | |
|----|---|------------------------|
| 11 |  | 1000x, 100µm scale bar |
| 12 |  | 1000x, 100µm scale bar |
| 13 |  | 1000x, 100µm scale bar |
| 14 |  | 1000x, 100µm scale bar |
| 15 |  | 1000x, 100µm scale bar |
| 16 |  | 1000x, 100µm scale bar |
| 17 |  | 1000x, 100µm scale bar |
| 18 |  | 1000x, 100µm scale bar |
| 19 |  | 1000x, 100µm scale bar |
| 20 |  | 1000x, 100µm scale bar |
| 21 |  | 1000x, 100µm scale bar |
| 22 |  | 1000x, 100µm scale bar |
| 23 |  | 1000x, 100µm scale bar |
| 24 |  | 1000x, 100µm scale bar |
| 25 |  | 1000x, 100µm scale bar |
| 26 |  | 1000x, 100µm scale bar |
| 27 |  | 1000x, 100µm scale bar |
| 28 |  | 1000x, 100µm scale bar |
| 29 |  | 1000x, 100µm scale bar |
| 30 |  | 1000x, 100µm scale bar |
| 31 |  | 1000x, 100µm scale bar |
| 32 |  | 1000x, 100µm scale bar |

- The authors gratefully acknowledge a grant from the National Institutes of Health (NIH) to support this work.

- [illegible]

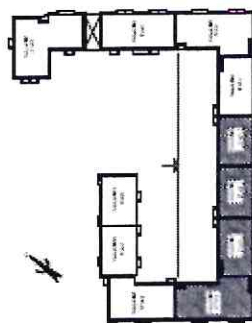

Всего в нем 13 (тринадцать) страниц

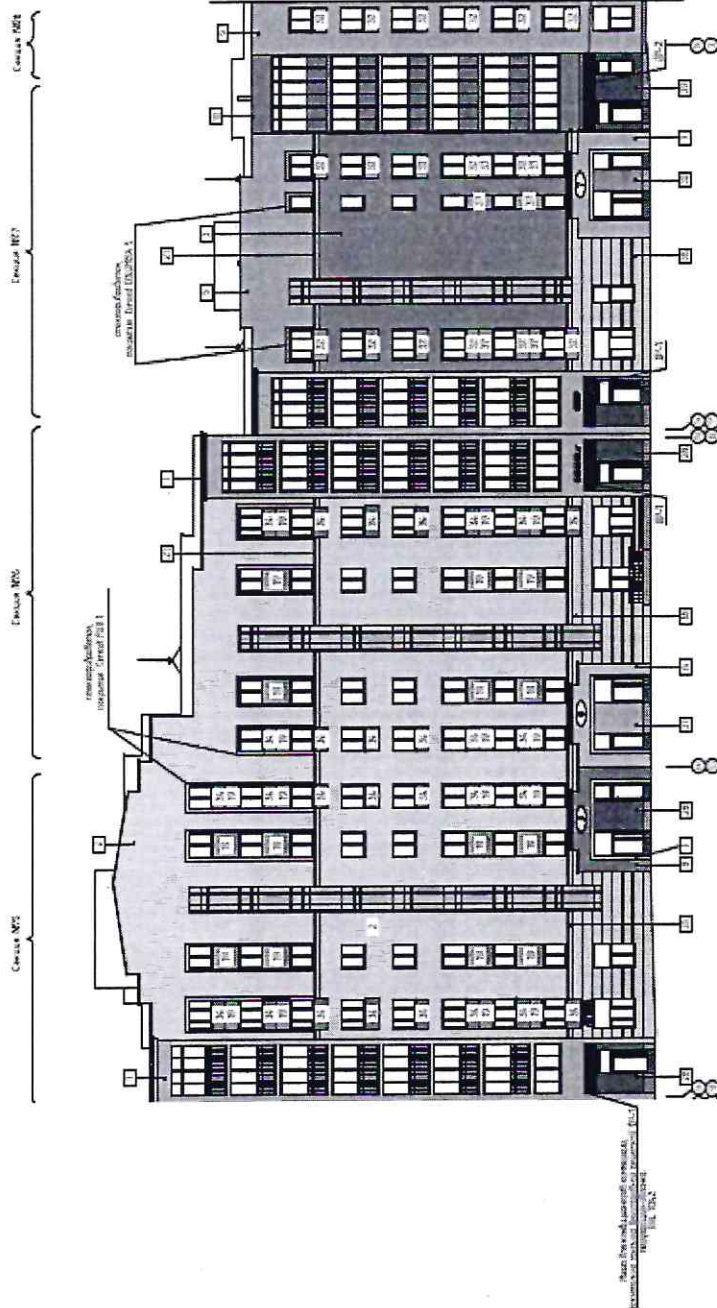

អង្គការសហប្រតិបត្តិការអន្តរជាតិ

1.  ☐ The graph shows that the function is not continuous at $x = 2$. The function has a jump discontinuity at $x = 2$. The function is continuous at $x = 1$ and $x = 3$.
 2.  ☐ The graph shows that the function is not continuous at $x = 2$. The function has a removable discontinuity at $x = 2$. The function is continuous at $x = 1$ and $x = 3$.
 3.  ☐ The graph shows that the function is not continuous at $x = 2$. The function has an essential discontinuity at $x = 2$. The function is continuous at $x = 1$ and $x = 3$.
 4.  ☐ The graph shows that the function is not continuous at $x = 2$. The function has a jump discontinuity at $x = 2$. The function is continuous at $x = 1$ and $x = 3$.


1.  A normal, well-organized lymph node with distinct cortical and medullary regions.
2.  A lymph node with a thickened cortex and hyperplastic follicles.
3.  A lymph node with a thickened cortex and hyperplastic follicles, showing more pronounced changes than image 2.
4.  A lymph node with a thickened cortex and hyperplastic follicles, showing significant architectural distortion.
5.  A lymph node with a thickened cortex and hyperplastic follicles, showing extensive architectural distortion and loss of normal structure.
6.  A lymph node with a thickened cortex and hyperplastic follicles, showing extensive architectural distortion and loss of normal structure, similar to image 5.
7.  A lymph node with a thickened cortex and hyperplastic follicles, showing extensive architectural distortion and loss of normal structure, similar to image 5.
8.  A lymph node with a thickened cortex and hyperplastic follicles, showing extensive architectural distortion and loss of normal structure, similar to image 5.
9.  A lymph node with a thickened cortex and hyperplastic follicles, showing extensive architectural distortion and loss of normal structure, similar to image 5.
10.  A lymph node with a thickened cortex and hyperplastic follicles, showing extensive architectural distortion and loss of normal structure, similar to image 5.

- [illegible]

1. The first step in the process of developing a business plan is to conduct a market analysis. This involves researching the industry, identifying potential customers, and understanding the competitive landscape. A thorough market analysis is essential for determining the viability of a business idea and for developing effective marketing strategies.
2. Once the market analysis is complete, the next step is to develop a business model. This involves determining how the business will generate revenue and how it will manage its costs. A clear business model is crucial for attracting investors and for ensuring the long-term sustainability of the business.
3. The third step in the process is to develop a financial plan. This involves projecting the business's financial performance over a period of time, typically three to five years. A detailed financial plan is necessary for assessing the business's profitability and for determining the amount of capital required to launch and operate the business.
4. The final step in the process is to develop a marketing plan. This involves identifying the target market, developing marketing strategies, and determining the budget for marketing activities. A well-defined marketing plan is essential for reaching potential customers and for building a strong brand identity.

© 2000 The American Psychological Association
0893-3200/00/\$12.00 DOI: 10.1037/0893-3200.14.4.475


2014年12月

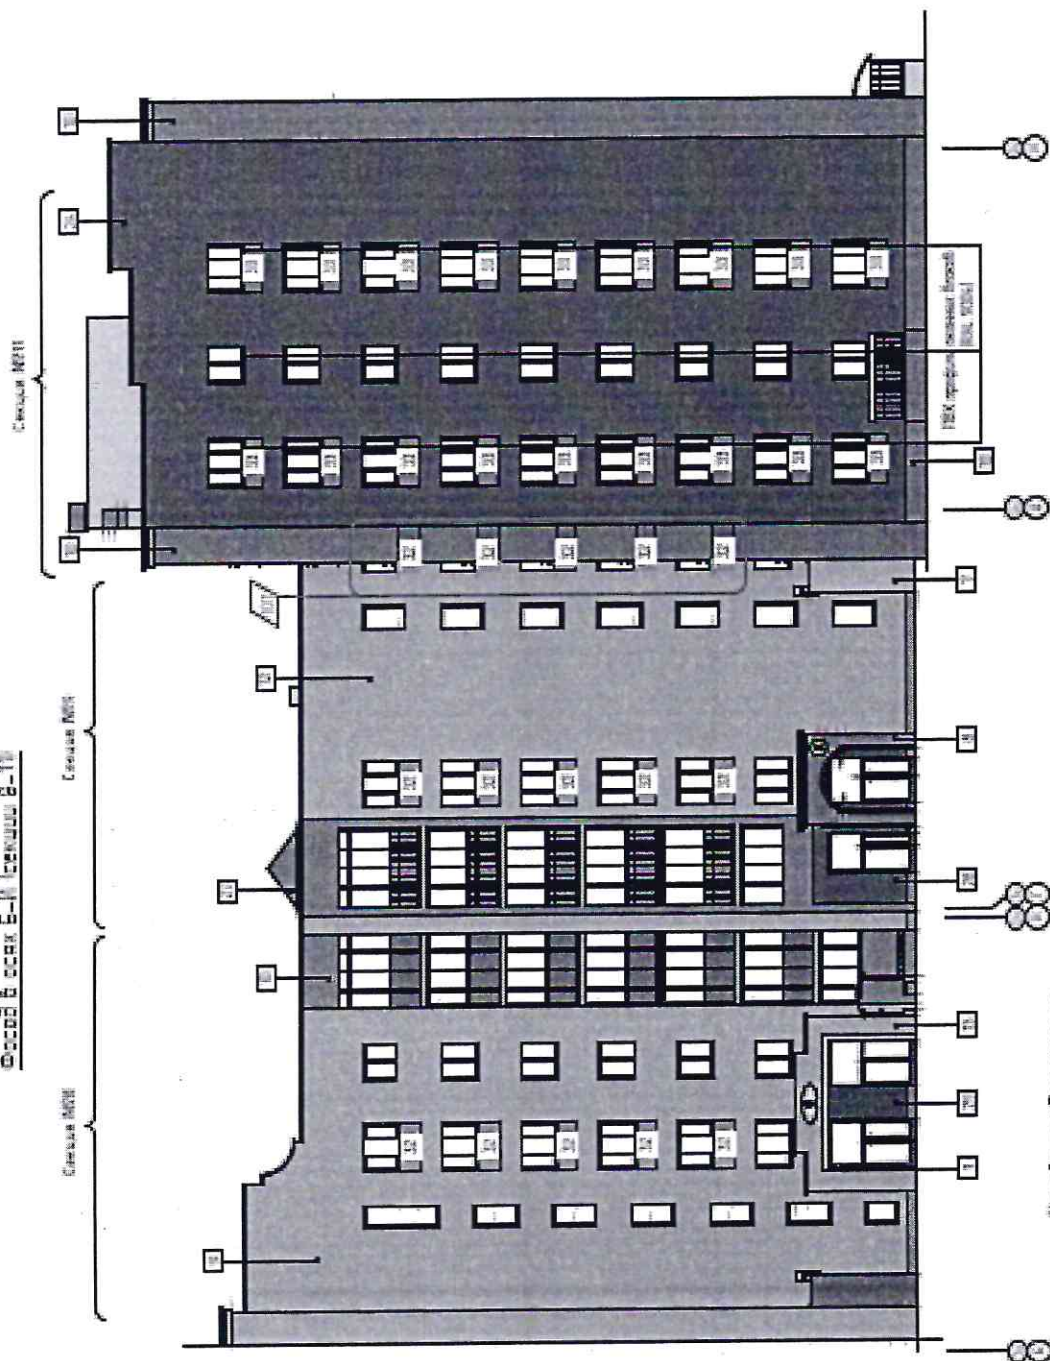[illegible]

Herodotus: 4.162-163

-

-
- Figure 1 consists of four panels, labeled a, b, c, and d, arranged vertically. Each panel contains a line graph and a photograph of a ground beef sample. The graphs show the growth of *E. coli* O157:H7 in log CFU/g over a 24-hour period. The y-axis for all graphs ranges from 0 to 10 log CFU/g, and the x-axis ranges from 0 to 24 hours. Panel (a) shows a control with a rapid increase in bacterial growth, reaching approximately 9 log CFU/g by 24 hours. Panel (b) shows a treatment that significantly reduces growth, reaching only about 4 log CFU/g. Panel (c) shows a treatment that further reduces growth, reaching about 3 log CFU/g. Panel (d) shows a treatment that results in the lowest growth level, reaching about 2 log CFU/g. The photographs show the ground beef samples at 0 and 24 hours, with the samples in panels (b), (c), and (d) appearing less dark and more uniform in color compared to the control in panel (a).

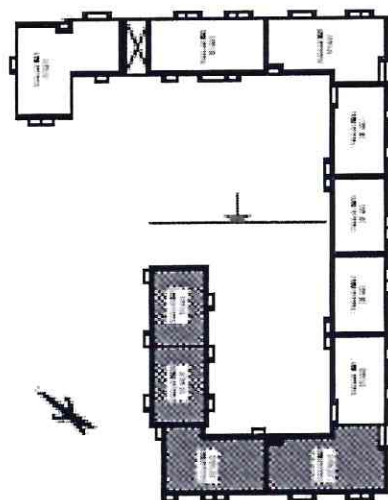

- [illegible]

- [illegible]

- ¹ *Journal of the American Medical Association*, 1991; 265: 1033.

- [illegible]

1998, 1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 2676, 2677, 2678, 2679, 26

Figure 1 consists of two panels, A and B, showing Western blot analysis of p38 phosphorylation. Panel A shows a Western blot of p38 in whole cell lysates from untreated (untreated) and treated (LPS) cells, probed with anti-phospho-p38 antibody. Panel B shows a Western blot of p38 in whole cell lysates from untreated (untreated) and treated (LPS) cells, probed with anti-p38 antibody. Molecular weight markers are indicated on the left.

[illegible]

醫學博士 醫學博士


© 2000 Blackwell Science Ltd

17

[illegible]

1.  **1** Normal, noninflamed, nonhyperplastic bronchus. The mucosa is thin and the lumen is large.
2.  **2** Mild inflammation and hyperplasia. The mucosa is slightly thickened and the lumen is slightly narrowed.
3.  **3** Moderate inflammation and hyperplasia. The mucosa is moderately thickened and the lumen is moderately narrowed.
4.  **4** Severe inflammation and hyperplasia. The mucosa is severely thickened and the lumen is severely narrowed.
5.  **5** Very severe inflammation and hyperplasia. The mucosa is very severely thickened and the lumen is very severely narrowed.

- [illegible]

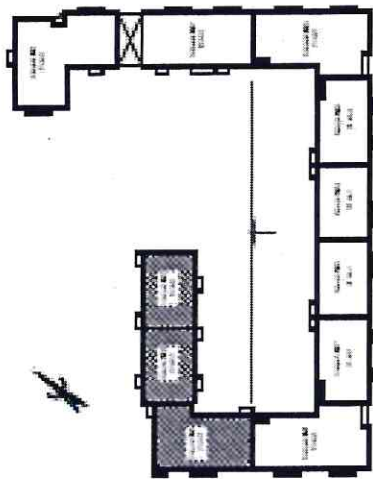

- There is a growing body of evidence that suggests that the use of a single, standardized, and validated instrument to assess the quality of care is a more reliable and valid method than the use of multiple, non-standardized, and non-validated instruments. The use of a single, standardized, and validated instrument to assess the quality of care is a more reliable and valid method than the use of multiple, non-standardized, and non-validated instruments.

[illegible]

100

[illegible]

Downloaded from <http://ajph.org/> on November 11, 2014

© 2004 Blackwell Publishing Ltd *Journal of Internal Medicine* 255: 111–117

© 2006 The Authors
Journal compilation © 2006 Blackwell Publishing Ltd

100

Фасад 6 осей 1,11 (этажи 8-5)



Условные обозначения

□ - Стеновые панели, облицованные керамическими плитками, размером 300х300 мм, цвет белый, глянцевый.

■ - Стеновые панели, облицованные керамическими плитками, размером 300х300 мм, цвет серый, матовый.


■ - Стеновые панели, облицованные керамическими плитками, размером 300х300 мм, цвет белый, матовый.

■ - Стеновые панели, облицованные керамическими плитками, размером 300х300 мм, цвет белый, матовый.

■ - Стеновые панели, облицованные керамическими плитками, размером 300х300 мм, цвет белый, матовый.


■ - Стеновые панели, облицованные керамическими плитками, размером 300х300 мм, цвет белый, матовый.

■ - Стеновые панели, облицованные керамическими плитками, размером 300х300 мм, цвет белый, матовый.

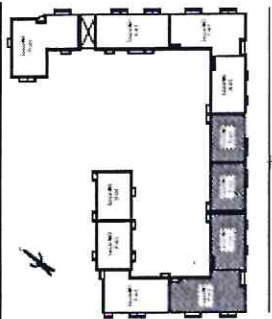




624

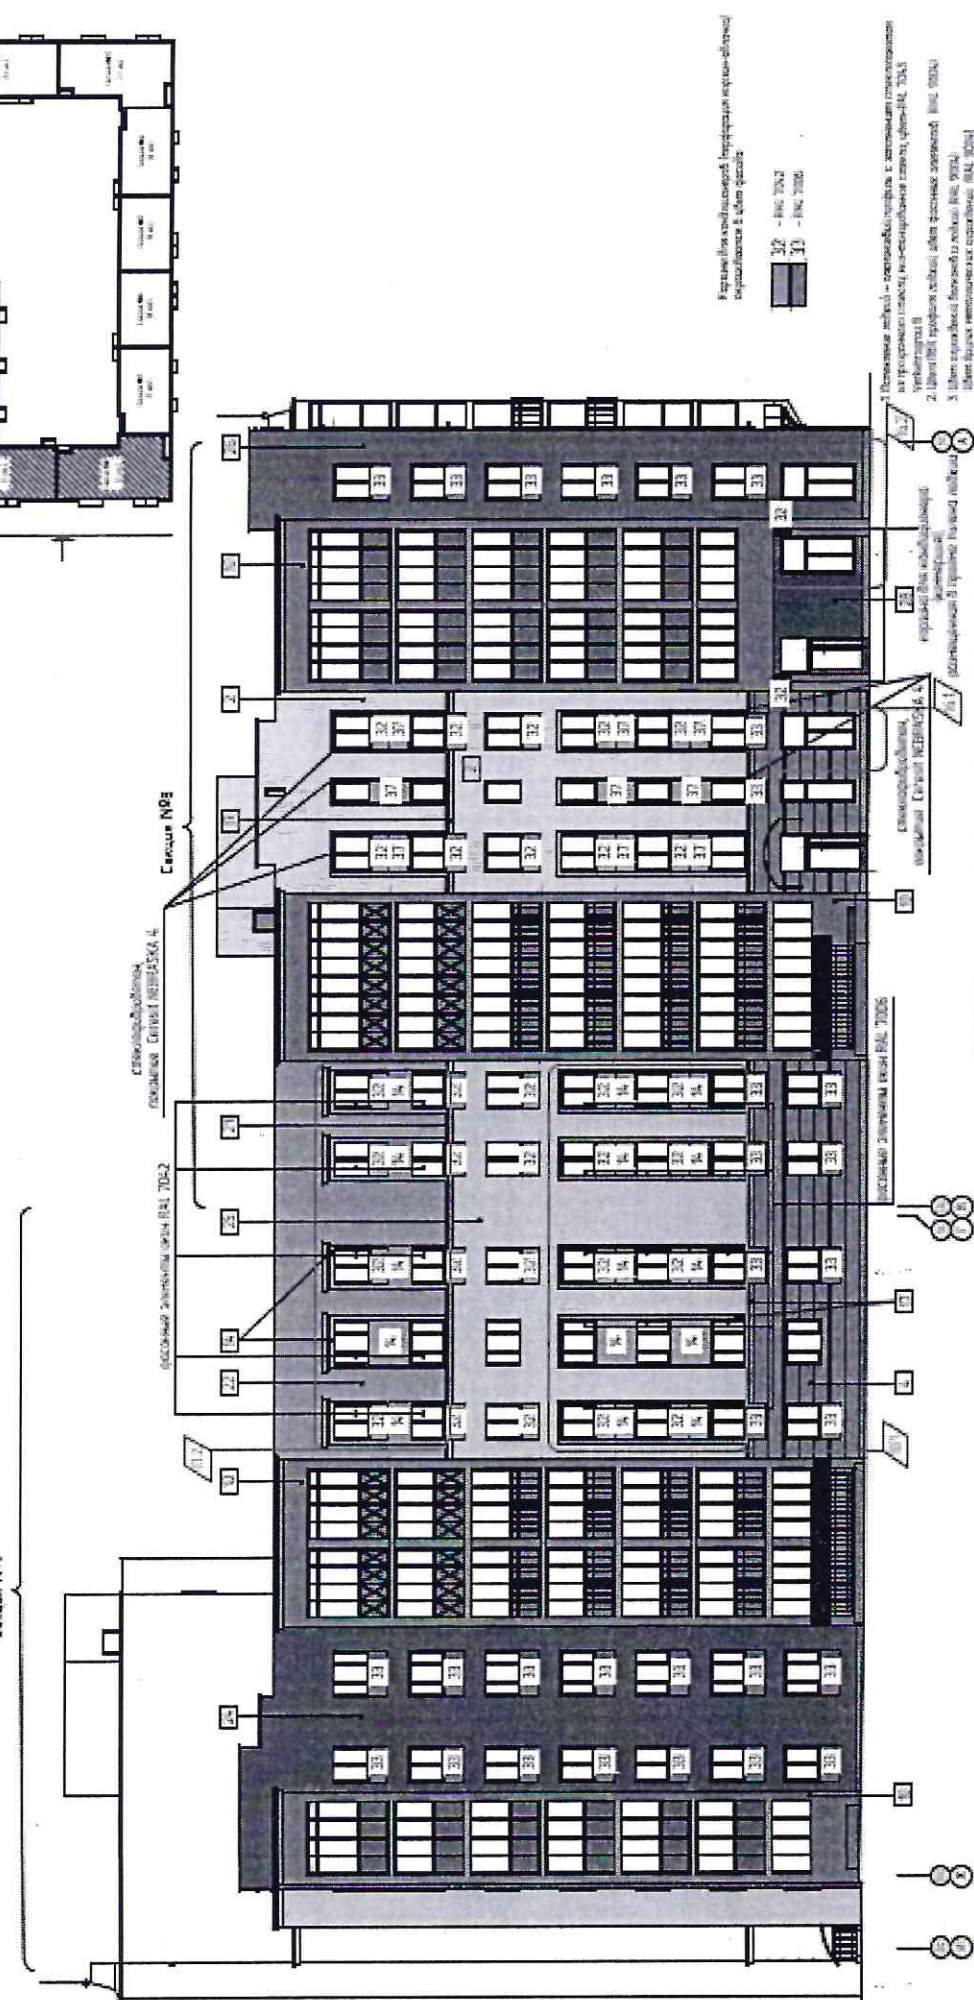


For a complete list of participating publishers, visit www.pearsoned.com/collegepublishing.

12	12
13	13
14	14
15	15
16	16
17	17
18	18
19	19
20	20
21	21
22	22
23	23
24	24
25	25
26	26
27	27
28	28
29	29
30	30
31	31
32	32
33	33
34	34
35	35
36	36
37	37
38	38
39	39
40	40
41	41
42	42
43	43
44	44
45	45
46	46
47	47
48	48
49	49
50	50
51	51
52	52
53	53
54	54
55	55
56	56
57	57
58	58
59	59
60	60
61	61
62	62
63	63
64	64
65	65
66	66
67	67
68	68
69	69
70	70
71	71
72	72
73	73
74	74
75	75
76	76
77	77
78	78
79	79
80	80
81	81
82	82
83	83
84	84
85	85
86	86
87	87
88	88
89	89
90	90
91	91
92	92
93	93
94	94
95	95
96	96
97	97
98	98
99	99
100	100

FIGURE 10-10 The effect of the β parameter on the probability of a stockholder's voting "yes" on a takeover proposal. The probability of a "yes" vote is plotted against the β parameter, which is assumed to be 0.5. The probability of a "yes" vote is 0.5 when β is 0.5. The probability of a "yes" vote is 0.4 when β is 0.4 and 0.6 when β is 0.6. The probability of a "yes" vote is 0.3 when β is 0.3 and 0.7 when β is 0.7. The probability of a "yes" vote is 0.2 when β is 0.2 and 0.8 when β is 0.8. The probability of a "yes" vote is 0.1 when β is 0.1 and 0.9 when β is 0.9. The probability of a "yes" vote is 0.0 when β is 0.0 and 1.0 when β is 1.0.

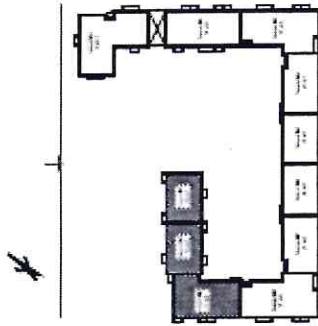

Фасад в разрезе 9-1 (размеры 1:50)

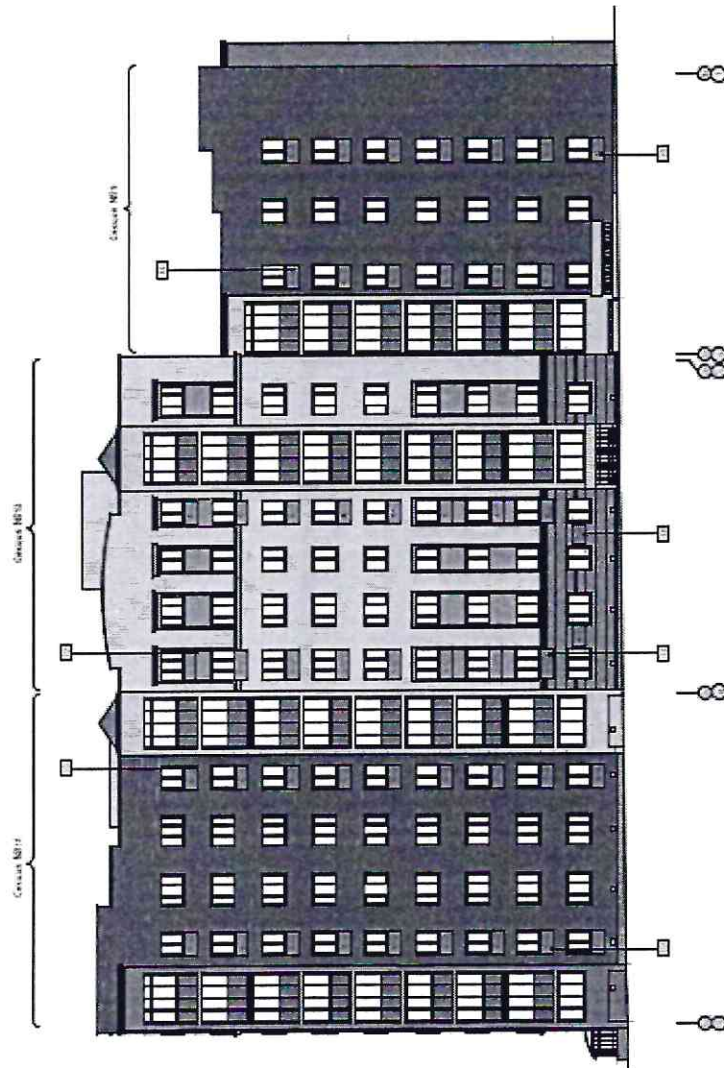

Легенда обозначений


Проектная документация на строительство
Лист 10 из 10
Архитектурный отдел
Инженер А.А. Сидоров

1:50 - 1:100 - 1:200



Свод в осев 11.3 (этажи 5-8)

Этажи 105, 106, 107, 108


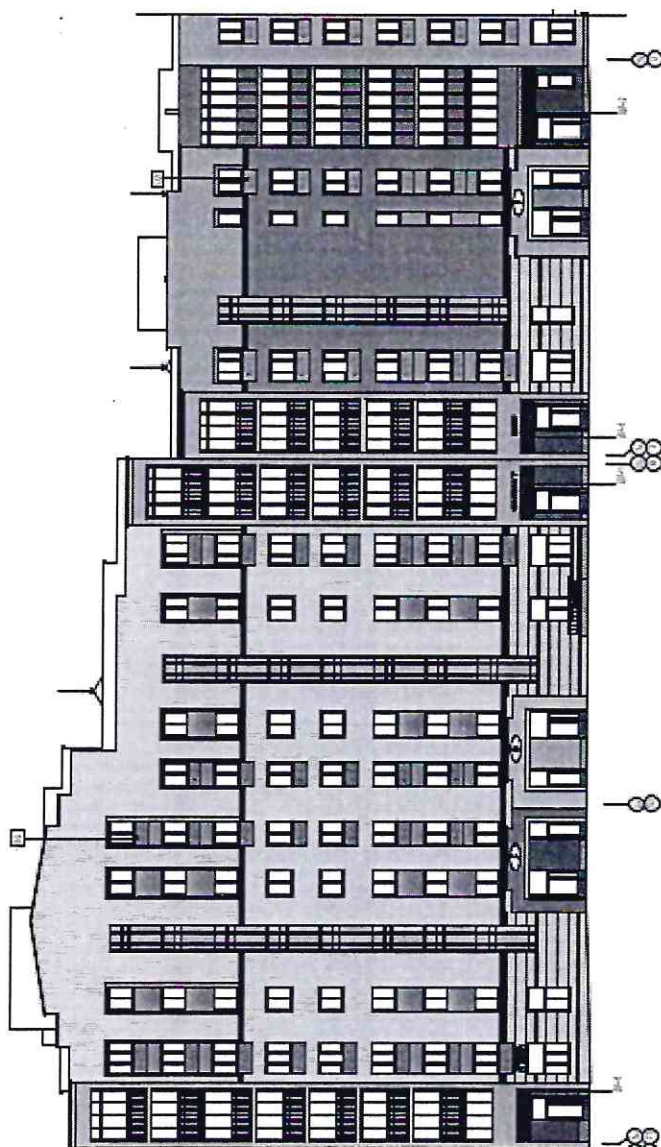


Условные обозначения

Документ создан для использования в 2D и 3D форматах. Все права защищены. Любое использование без разрешения АЗБУКА является нарушением.

105 106 107 108


Downloaded by guest on May 12, 2015

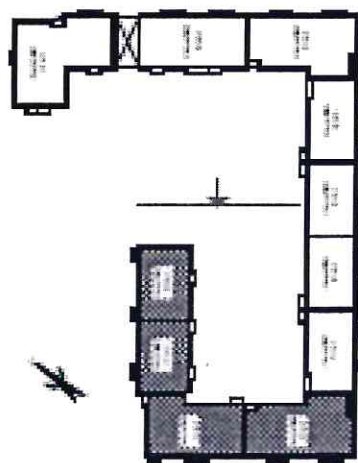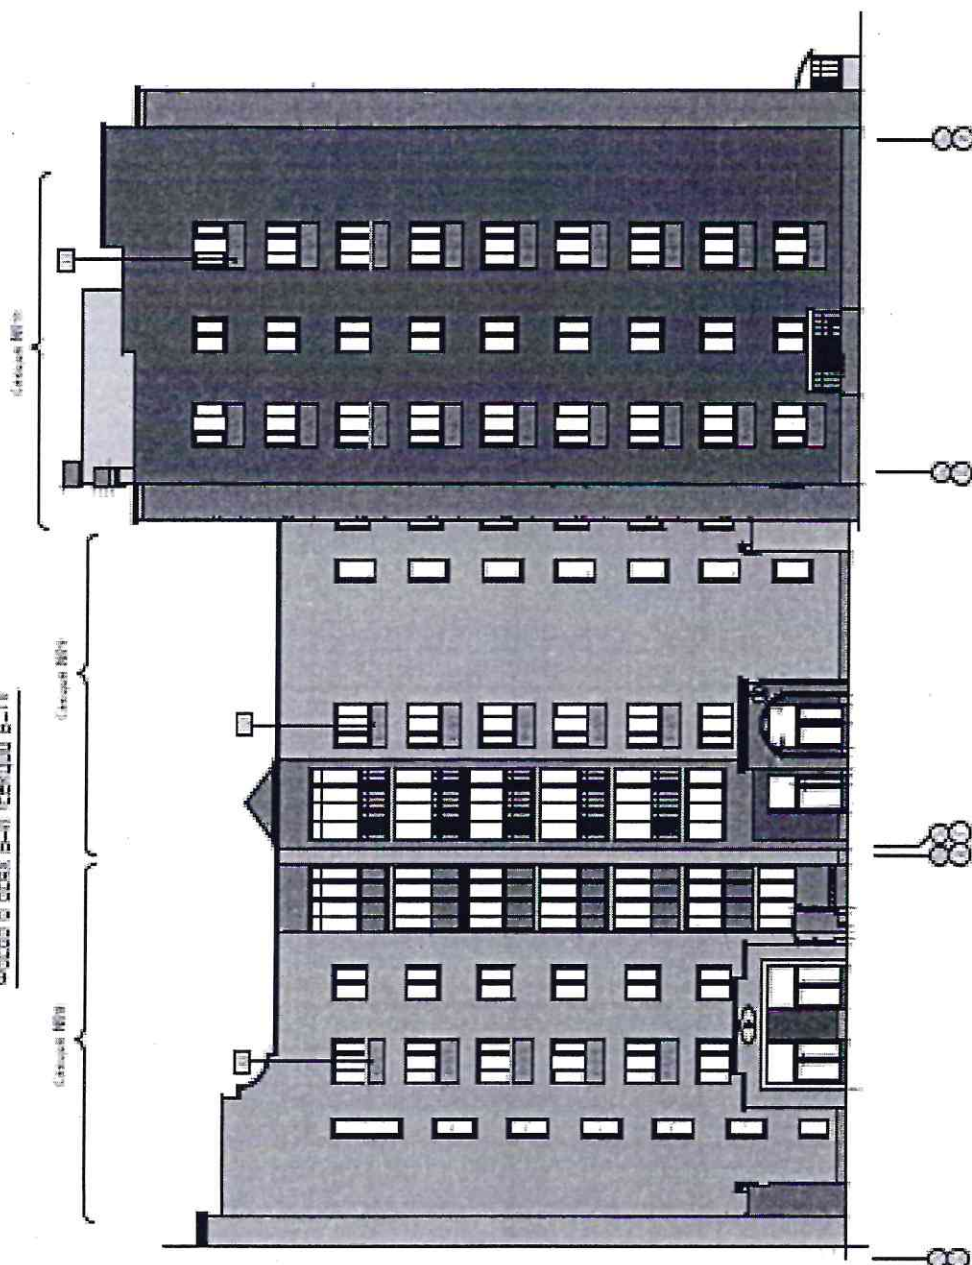

התאחדות העובדים

1. The first step is to identify the problem or question that needs to be answered. This involves understanding the context and the specific requirements of the task.

Reprints from this publication may be purchased from the American Psychological Association, 750 First Street, N.E., Washington, D.C. 20002.

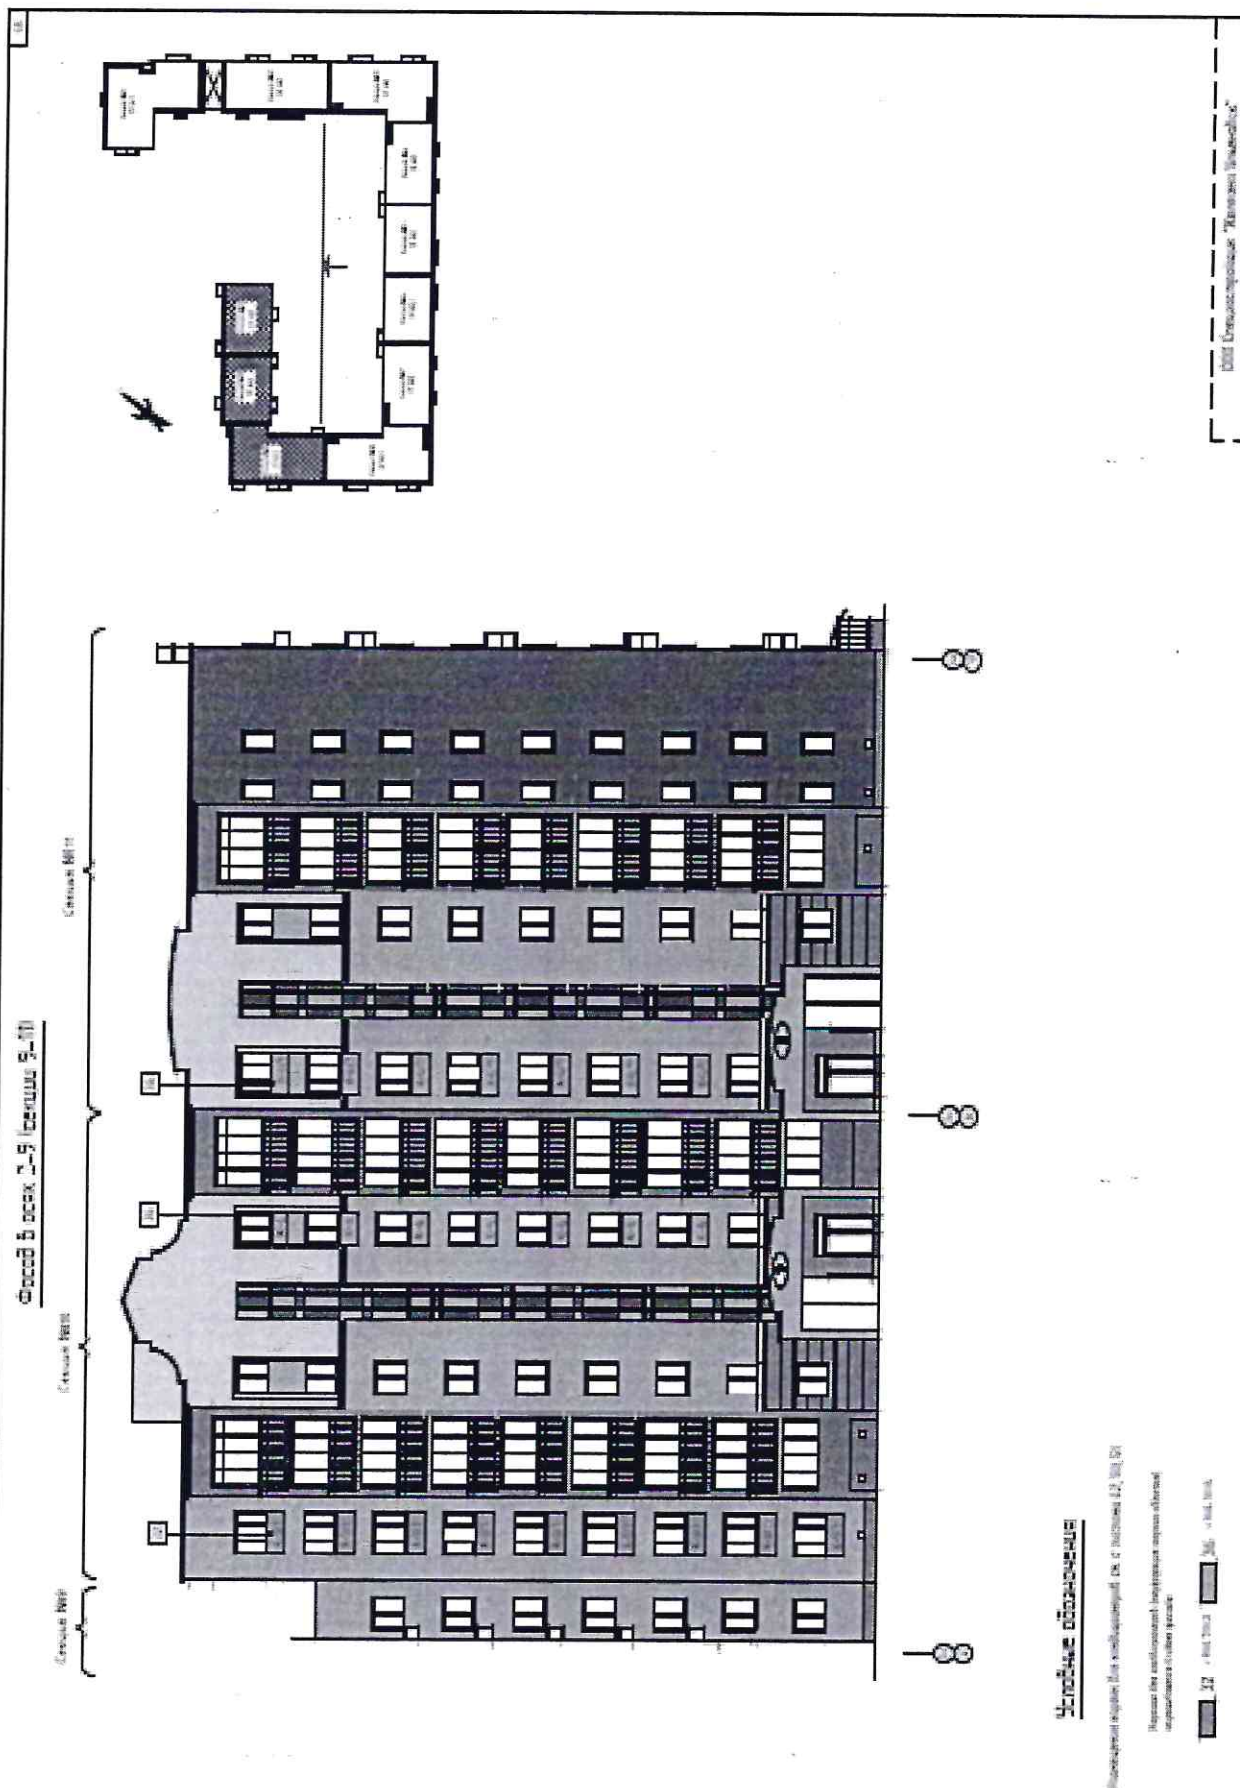


Условные обозначения

Рассмотрено и одобрено для использования: от 12.01.2012 г.

Разработано и одобрено: инженером архитектурного бюро


32 - 12.01.2012 г.

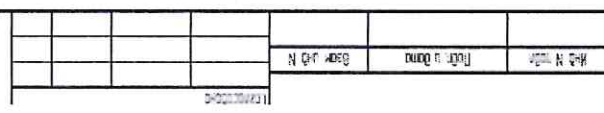
[illegible]

Стадия	Лист	Листов
Р		

ООО "Масштаб"

Формат А.3

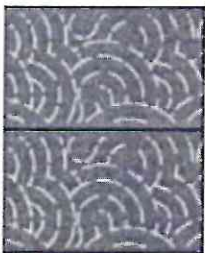Поз.	Обозначение	Эскиз	Габаритные размеры	Примечание
К-1	Корзина для кондиционера заводского изготовления (сертифицированное изделие) перфорация облачко		1400x750 (h)мм	RAL7042
К-1/1			1800x750 (h)мм	RAL7042
К-1/3			1800x1200 (h)мм	RAL7042
К-1/4			910x750(h)мм (размещение в проемах пилонов лоджий)	RAL7042
К-2			1400x750 (h)мм	RAL1036
К-2/1			1800x750 (h)мм	RAL1036
К-3			1400x750 (h)мм	RAL7006
К-3/1			1800x750 (h)мм	RAL7006
К-3/2			1800x750 (h)мм	RAL7006
К-3/4			800x750 (h)мм	RAL7006

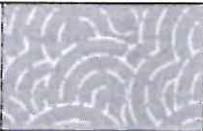К-4			1400x750 (h)мм	RAL1034
К-4/1			1400x750 (h)мм	RAL1034
ДР-1	Декоративная решетка (перфорация облачко)		2990x750 (h)мм	RAL7042
ДР-2	Декоративная решетка (перфорация облачко)		4630x750 (h)мм	RAL7042